

Baby Lock Aria (Model BLAR) Software Update Version 3.03

February 2018

Introduction


If the software version of your Aria (Model BLAR) is earlier than version 3.03, an update program is now available for download to improve its performance.

Version 3.03 update will provide the following changes:

1. Improved machine's functionality for returning the presser foot to the proper position after canceling the free motion sewing mode.

To confirm the software version of your BLAR

- 1. Press the power switch to turn on your machine. The LCD screen comes on.
- 2. Touch anywhere on the initial screen.
- 3. Press (Machine Setting Mode Key) at the bottom of the display. The settings screen appears.
- 4. Switch screens by using (Previous page key) or (Next page key) to display the software version.

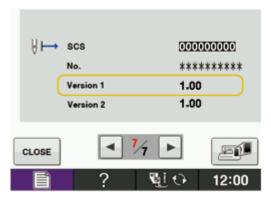

5. If "Version1" shown in the screen is already 3.03 or later, it is not necessary to update your machine with the software on this page.

If "Version1" shown in the screen is lower than 3.03, follow the procedure to update your machine.



How to download the update program

- 1. Create a temporary folder (ex. C:\Temp) on your computer to save the update program file to be downloaded.
- 2. Click the "DOWNLOAD FILE" below.
- 3. Select the previously created temporary folder (ex. C:\Temp) where the downloaded file should be stored.
- 4. Download the file.

Download FILE (V_V303_tacoBsc_A.upf, size: 49.8 MB)

How to update your machine's software

The following two methods are available to update your machine's software.

- 1. Update procedure using USB media
- 2. Update procedure using a computer connection (USB Function)

Follow the procedure described in the instruction manual.

<u>Instruction PDF</u> (File size: 580 KB)

* * * NOTE * * *

- Do not turn off your machine while the machine is saving the update software to itself. If the machine's power is turned off while saving the update software, it may result in damage to the machine.
- When using USB Flash drive (USB Flash memory) to update the machine's software, check that no data except for the update file is saved on the USB Flash drive (USB Flash memory) being used before beginning update.
- When using a computer connection to update the machine's software, check your computer's operating system.
 USB functionality is only available to be used with Microsoft Windows 7/8.1/10.



Baby Lock Aria (Model BLAR) Update History

Version 3.02 update provided the following changes.

1. Improved machine's functionality for Automatic Presser Foot Lift functions.

This function cannot be used when using the function to specify the sewing end point with the sensor pen.

The function can only be used with stitches where presser foot "J", "N" or "X" is indicated in the upper-left corner of the screen. If any other stitch is selected, it is not available.

Note:

Automatic Presser Foot Lift functions are only available for BLTYU2 (Sewing Upgrade for BLTY, BLJY, BLCR, BLAR) users.

2. Modified the illustrations for explaining the usage of a certain stitch in the sewing guide function.

➤ Version 3.01 update provided the following changes.

1. Functionality update for only Upgrade Kit 2 (BLTYU2) users.

Version 2.01 update provided the following changes.

1. Added the Reinforcement Priority function.

"Reinforcement Priority" has been added to page 3 of the settings screen.

To learn the new feature, read the following instructions.

Instructions for using Reinforcement Priority

[Added Features of Version 2.0] (File size: 744 KB).

* This feature is available for the sewing functions only.

2. Improved the following sewing function.

The sewing speed for decorative stitches. (from 400 spm to 710 spm)

The speed to begin sewing utility stitches and decorative stitches. (from 70 spm to 110 spm)

* "spm" is the number of stitches sewn in one minute.



- 3. Enhanced the texture of hand-look quilting stitch.
- 4. Improved machine's functionality for the following features or some issues.
 - 4-1. Selecting or editing stitch patterns in the Utility Stitch Screen

➤ Version 1.12 update provided the following changes.



1. Fixed the situation where the machine may not sew reinforcement stitches correctly when using the pivot function or the free motion sewing mode.